



**NUMBER:** 23-052-05

**GROUP:** Body

**DATE:** November 4, 2005

**THIS BULLETIN IS BEING PROVIDED IN ADVANCE. DO NOT ORDER PARTS OR PERFORM ANY ACTIONS RELATED TO THIS BULLETIN UNTIL NOVEMBER 21, 2005.**

**SUBJECT:**

Rear Fascia To Body Side/Tail Lamp Fit

**OVERVIEW:**

This bulletin involves adding two nut and bolt attachments to the rear fascia.

**MODELS:**

2005 - 2006 (LX/LE) 300/Charger

**SYMPTOM/CONDITION:**


The gap between rear fascia and body side/tail lamp is more than 2mm (5/64 in).

**DIAGNOSIS:**

If gap between rear fascia and body side/tail lamp measures more than 2mm (5/64 in), ([Fig. 1](#)), perform the Repair Procedure.



**Stick with the Specialists™**

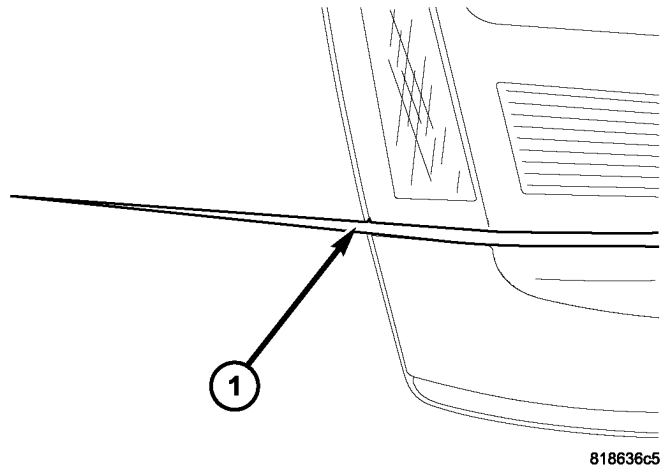

**Fig. 1 FASCIA TO BODE SIDE/TAIL LAMP GAP**


1 - GAP SHOWN GRATER THAN 2MM (5/64 IN.)

**PARTS REQUIRED:**

Qty.	Part No.	Description
2	06505546AA	Bolt
2	06104726AB	Nut
AR	04318031	Adhesive, MOPAR Lock & Seal Adhesive (One tube will service 100's of vehicles.

**REPAIR PROCEDURE:**

1. Open the trunk lid.
2. Pull the trunk carpet away from one side of the trunk.
3. Remove the push pin (located above and rearward of the body exhauster) attaching the fascia to the body side, by pushing out the center (white) pin with a punch, then push (black) body through hole, (Fig. 2). Pin and body will fall to the ground under the rear fascia.

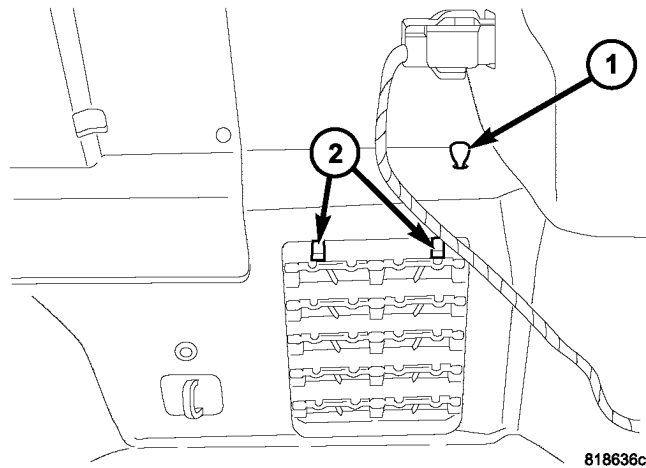

**Fig. 2 PUSH PIN LOCATION**

- 1 - PUSH PIN
- 2 - EXHAUSTER RETAINER TABS

4. Apply a drop of MOPAR Lock & Seal Adhesive, p/n 04318031, to the threads of bolt, p/n 06505546AA.
5. Insert bolt, p/n 06505546AA, downward through the push pin hole.
6. Remove the body air exhauster by pushing down on the retaining tabs, and pushing the exhauster through opening.
7. Hand start nut, p/n 06104726AB, onto the bolt through the exhauster opening.
8. Tighten the nut and bolt to 11 Nm (100 in. lbs.).
9. Install the body air exhauster.
10. Return the trunk side carpet to its original position.
11. Repeat steps 2-10 for the other side repair.
12. Close the trunk lid.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Amount
13-20-05-90	Refit Rear Fascia	0.3 Hrs.

**FAILURE CODE:**

ZZ	Service Action
----	----------------