



TECHNICAL BULLETIN
JTB00268NAS2
04 DEC 2012

© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

Changes are highlighted in gray

SECTION: 303-00

Engine Hard to Start After Hot-Soak

AFFECTED VEHICLE RANGE:

XF (X250) - 4.2L Naturally aspirated only

Model Year: 2009-2010

VIN: R00001-R47153

XJ Range (X350) - 4.2L Naturally aspirated only

Model Year: 2006-2009

VIN: G49701-H30057

XK Range (X150) - 4.2L Naturally aspirated only

Model Year: 2007-2009

VIN: B00001-B32752

MARKETS:

NAS

CONDITION SUMMARY:

Situation: On vehicles fitted with the 4.2L naturally aspirated engine only, the engine may experience a rough start or stall following a hot soak of 15-20 minutes.

Cause: This may be caused by the fueling calibration not being robust for winter blend 10% ethanol fuel.

Action: In the event of a customer concern of the above, refer to the Repair Procedure outlined below to update the Engine Control Module (ECM) software.

PARTS:

No Parts Required

TOOLS:

IDS with latest IDS-DVD and Calibration File; first available on DVD131.01 v.114
Jaguar Land Rover-approved Midtronics Vehicle Power Supply

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART

Reprogram Existing E.C.M. Using IDS/SDD - XF	86.99.13	0.20	42	C2Z3051
Reprogram Existing E.C.M. Using IDS/SDD - XJ, XK	86.99.13	0.30	42	C2Z3051



NOTE: Normal Warranty policies and procedures apply.

REPAIR PROCEDURE:

1.  **CAUTION: Ensure all ignition 'ON' / ignition 'OFF' requests are carried out; failure to perform these steps may cause damage to control modules in the vehicle.**



CAUTION: A Jaguar Land Rover-approved Midtronics Vehicle Power Supply must be connected to the vehicle battery during IDS / SDD diagnosis / module programming.



NOTE: IDS must be loaded with DVD131.01 v.114 or later.

Connect the Jaguar Land Rover-approved Midtronics Vehicle Power Supply to the vehicle battery.

2. Turn ignition 'ON' (engine not running).
3. Connect the IDS to the vehicle and begin a new Symptom Driven Diagnostics (SDD) session.
4. Follow the on-screen prompts, allowing SDD to read the VIN and identify the vehicle.
5. Where no internet connection is available:
 1. From the Session Type selection screen, choose 'Diagnosis'.
 2. Select the 'Selected Symptoms' tab, and then select one of the following:
 - Powertrain > Engine system > Engine performance > Engine cuts out – when hot **or**
 - Powertrain > Engine system > Engine performance > Engine judders and shakes – when hot
 3. Select 'continue'.
 4. Select the 'Recommendations' tab.
 5. From the Recommendations tab, select '**Run**' to perform the 'Configure existing module – Powertrain control module' option.
6. Follow all on-screen instructions to complete this task.
7. Exit the current session.
8. Disconnect the IDS and the vehicle power supply from the vehicle.