



MODEL
2007 XK

DATE
06 June 2006

NUMBER
XK206-001

SERVICE

TECHNICAL BULLETIN

SECTION: 206-03

Front Brake Caliper Creak

AFFECTED VEHICLE RANGE:

New XK

VIN: B00001 onwards

Model Year: 2007 onwards

CONDITION SUMMARY:

CREAK FROM FRONT BRAKE CALIPER


Situation: A customer may express a concern of a creak noise emanating from the front brakes under light brake application, at slow speed, and while steering. The noise may also be heard under light or medium braking while coming to a stop with the steering wheel in a straight-ahead position. Surface contact between the caliper carrier and brake pad anchor points may be the cause.

Action: Should a customer express concern of a creak from a front brake caliper, refer to the Repair Procedure detailed in this bulletin to clean and grease the front caliper carrier and brake pad anchor surfaces.

PARTS:

C2C33568.....Grease sachet Qty 1

WARRANTY:

 **NOTE:** Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to DDW to obtain the latest repair time.

DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

<i>Description</i>	<i>SRO</i>	<i>Time (Hours)</i>	<i>Condition Code</i>	<i>Causal Part</i>
Remove front brake calipers and lubricate	70.40.02	0.5		C2C33568

Normal warranty policy and procedures apply.

NOTE: The information in Technical Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers." If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether the bulletin applies to a specific vehicle.

REPAIR PROCEDURE

CLEAN AND GREASE FRONT CALIPER BRAKE PAD ANCHOR SURFACES



NOTE: GTR lookup sequence is as follows:

GTR Home > NAS > Service Information/ X150 - XK/2007 > Workshop Manuals > New XK – Workshop Manual > Bookmark "Chassis/Brake System/206-03: Front Disc Brake" > Removal and Installation Link "Brake Pads – Vehicles With: Standard Brakes (70.40.02)"

1. Refer to Global Technical Reference (GTR) Workshop Manual section 206-03, operation 70.40.02 and remove front brake pads.
2. Clean the brake pad anchor surfaces of the caliper carrier. (Arrowed in Figure 1)
3. Grease the brake pad anchor surfaces of the caliper carrier. (Arrowed in Figure 1)
4. Refer to GTR section 206-03, operation 70.40.02 and install front brake pads.
5. Repeat steps 1-4 on the opposite side front brake caliper carrier.

