



X-TYPE

DATE 09/03

XT308-02

SERVICE

TECHNICAL BULLETIN

Clutch Pedal Sticking Down –
Install Additional Spring –
Repair

MODEL 2002 MY-ON
X-TYPE
VIN C00001-ON

Issue:

On some 2002 MY-ON X-TYPE vehicles with manual transmissions, customers may complain that the clutch pedal will stick in the down position intermittently, and will not return unless lifted manually.

A new spring has been released that can be installed in addition to the existing spring, in order to alleviate this concern.

Action:

In case of a verified customer complaint of the above condition, follow the workshop procedure outlined below:

INSTALLING ADDITIONAL SPRING

1. Remove driver's stowage compartment.
2. Remove driver's side dash liner.

NOTE: The information in Technical Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers." Do not assume that a condition described affects your car. Contact a Jaguar retailer to determine whether the Bulletin applies to your vehicle.

INSTALLATION OF ADDITIONAL SPRING

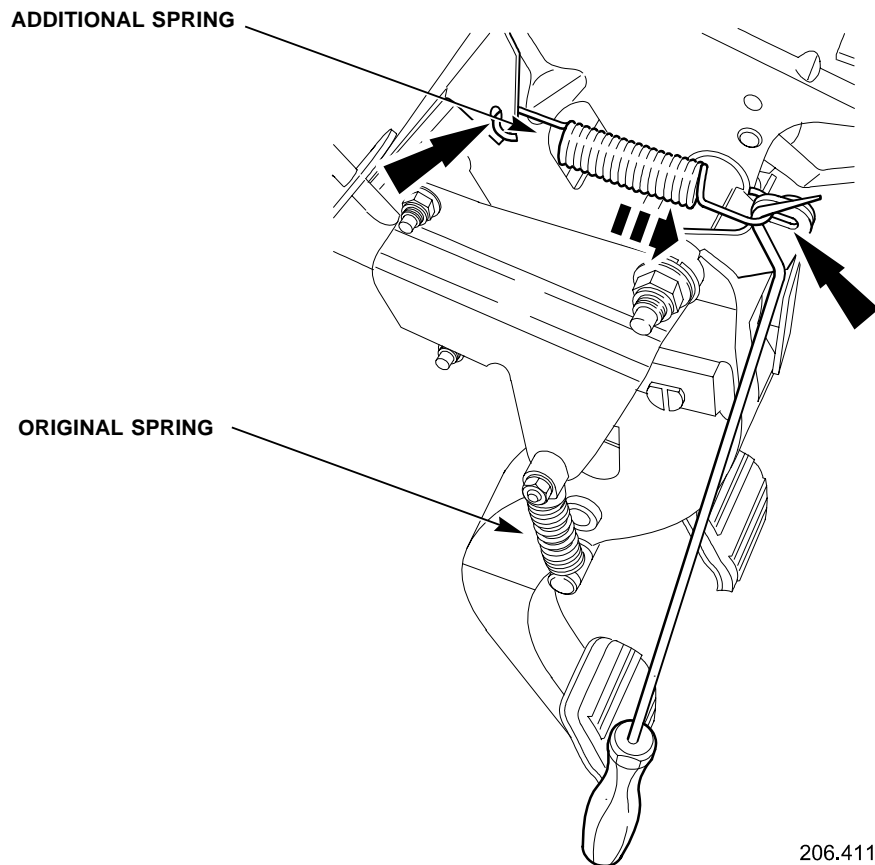


ILLUSTRATION 1

3. Install one end of the new spring to the clutch pedal housing bracket. Install the other end of the new spring to the clutch pedal bracket (Illustration 1).

Note: A suitable tool ('Snap On' A1710 or similar) will be required to aid with the installation of the new spring to the clutch pedal. The tool should be long enough to be used by both hands to generate enough force to expand the spring.

4. Install driver's side dash liner.
5. Install driver's stowage compartment.

Parts Information:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Clutch pedal spring	C2S 34897	1

Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Install clutch pedal spring	33.91.02	0.2 hrs.	C2S 34897