



**Technical Service
Information Bulletin**

June 18, 2002

Title:

**FRONT STABILIZER BAR
ABNORMAL NOISE**

Models:

'00 – '02 GS 430/400/300 & '02 SC 430

**SUSPENSION
SU003-02
REVISED**

Introduction To eliminate abnormal noise by the front stabilizer bar when driving over bumps and/or cornering, the bolt tightening torque of the mounting hardware must be checked and adjusted if below specification.

- Applicable Vehicles**
- **2000 – 2002** model year **GS 300** vehicles built prior to the starting VIN.
 - **2000 – 2002** model year **GS 430/400** vehicles built prior to the starting VIN.
 - **2002** model year **SC 430** vehicles built prior to the starting VIN.

**Production
Change
Information**

MODEL	STARTING VIN
GS 300	JT8BD69S#20158849
GS 430	JT8BL69S#20009597
SC 430	JTHFN48Y#20020870

**Parts
Information**

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
90119-08C02	Same	Bolt (Front Stabilizer Bar Bracket "A")	8
90119-08C04	Same	Bolt (Front Stabilizer Bar Bracket "B")	4

**Warranty
Information**

MODEL	OP CODE	DESCRIPTION	TIME	OPN	T1	T2
GS 430/400/300	SU1003	Re-Torque Stabilizer Bolts "A" & "B"	0.5	90119-08C04	91	81
SC 430	SU1004	Re-Torque Stabilizer Bolts "A" & "B"	0.6			


Applicable Warranty*:

This repair is covered under the Lexus Comprehensive Warranty. This warranty is in effect for 48 months or 50,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



**Bolt
Locations**

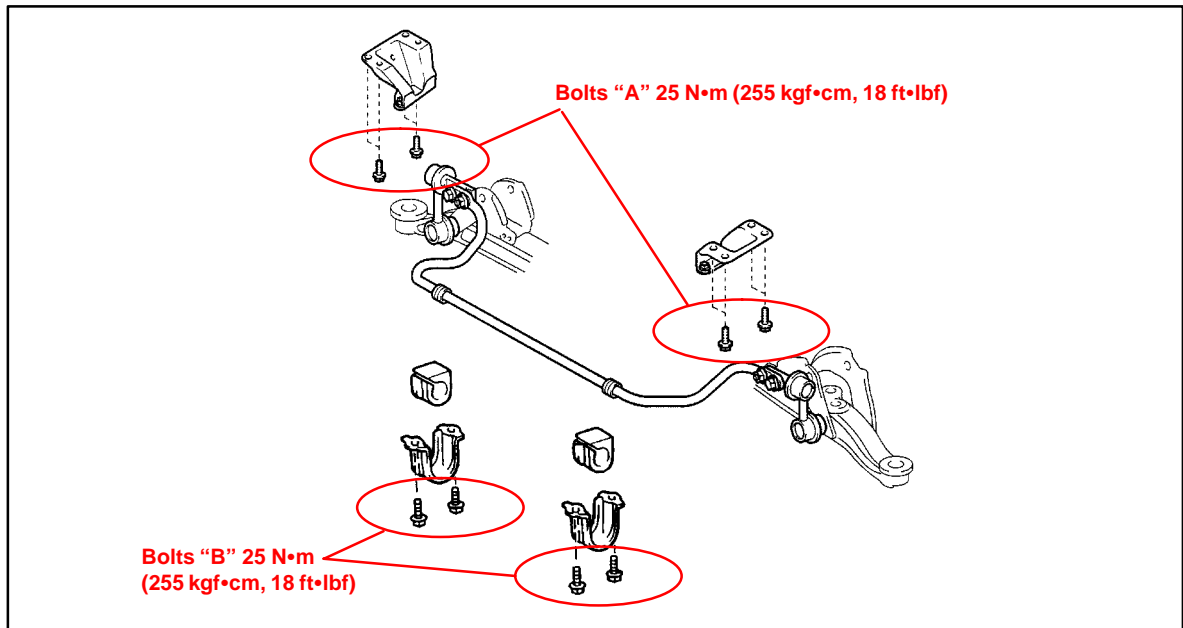

NOTE:

Do not apply any foreign material (such as thread locking compound or lubricant) to the bolt threads before tightening the bolts to the proper torque value.